

# PRIMO ACOUSTIC technical data

| CERTIFICATION & CLASSIFICATION | STANDARDS | Primo Acoustic                                  |
|--------------------------------|-----------|---|
| Type of floor covering         | ISO 11638 | Homogeneous vinyl flooring with foam interlayer |
| Binder content                 | ISO 11638 | Type II   |
| CE certification               | EN 14041  | Yes   |
| Classification                 | ISO 10874 | Commercial: 34<br>Industrial: 42                |

| TECHNICAL CHARACTERISTICS   | STANDARDS                     | Primo Acoustic   |
|-----------------------------|-------------------------------|--|
| Surface treatment           |                               | PUR reinforced   |
| Total thickness             | ISO 24346                     | 3.7 mm   |
| Wear layer thickness        | ISO 24340                     | 2.0 mm   |
| Foam layer thickness        | ISO 24340                     | 1.5 mm   |
| Adhesive foil thickness     | ISO 24340                     | 0.2 mm   |
| Total weight/m <sup>2</sup> | ISO 23997                     | 3600 g   |
| Form of delivery            | ISO 24341<br>Sheet<br>(rolls) | Approx. 23 lm x 200 cm<br>Art. no. 21014 ____<br>3 digit colour number |

| TECHNICAL PERFORMANCES  | STANDARDS                                     | Primo Acoustic   |
|-------------------------|---|--|
| Dimensional stability   | ISO 23999                                     | ≤ 0.40 % for rolls   |
| Reaction to fire        | EN 13501-1<br>EN ISO 9239-1<br>EN ISO 11925-2 | Class B <sub>fl</sub> s1<br>≥ 8 kW/m <sup>2</sup><br>Pass        |
| Residual indentation    | ISO 24343-1                                   | Required value: ≤ 0.20 mm  |
| Castor chair test       | ISO 4918                                      | Suitable   |
| Flexibility             | ISO 24344                                     | Pass   |
| Clean room test         | ASTM F24 F51<br>ISO 14644-1                   | Class A<br>ISO class 4   |
| Ease of decontamination | ISO 8690                                      | Good   |
| Impact sound reduction  | EN ISO 717/2                                  | Approx. + 17 dB  |
| Total VOC emissions     | AgBB/DIBt<br>Indoor air quality               | ≤ 10 µg/m <sup>3</sup> (after 28 days)<br>Platinum               |
| Underfloor heating      |   | Suitable – max. 27°C   |
| Thermal resistance      | EN 12667                                      | Approx. 0.01 m <sup>2</sup> K/W                                  |
| Light fastness          | EN ISO 105-B02                                | ≥ level 6  |
| Bacteria resistance     | ISO 846:Part C                                | Does not favour growth   |
| Slip resistance         | DIN 51130<br>EN 13893<br>BS 7976-2            | R9<br>≥ 0.3<br>Low risk of slip                                  |
| Seam strength           | EN 684  | Average value: ≥ 240 N/50 mm<br>Individual values: ≥ 180 N/50 mm |
| Colours                 |   | 18   |


The above information is subject to modification for the benefit of further improvement. (05/16).

CUSTOMS TARIFF : 48205000000F

Tarkett's instructions regarding installation, cleaning and maintenance should be observed. Please contact Tarkett at the address shown for these instructions.

| Primo Acoustic | NCS No.     | Welding Rod No. | Primo Acoustic | NCS No.     | Welding Rod No. | Primo Acoustic | NCS No.     | Welding Rod No. |
|----------------|-------------|-----------------|----------------|-------------|-----------------|----------------|-------------|-----------------|
| 651            | S 1000-N    | 1290 152        | 670            | S 2000-N    | 1290 222        | 676            | S 5005-Y50R | 1290 218        |
| 657            | S 2005-Y50R | 1290 158        | 671            | S 4000-N    | 1290 022        | 678            | S 1005-Y40R | 1290 232        |
| 658            | S 2005-Y40R | 1290 159        | 672            | S 1502-Y50R | 1290 220        | 679            | S 2010-G30Y | 1290 219        |
| 659            | S 3010-Y40R | 1290 160        | 673            | S 3502-B    | 1290 225        | 680            | S 3020-G30Y | 1290 059        |
| 665            | S 3030-R90B | 1290 164        | 674            | S 6502-B    | 1290 228        | 681            | S 4030-G30Y | 1290 233        |
| 666            | S 4040-R90B | 1290 165        | 675            | S 1002-Y50R | 1290 229        | 682            | S 2020-R90B | 1290 234        |

■ **WESTERN EUROPE:** Austria: Tarkett Holding GmbH, Niederlassung Wien – Tel. +43 1 47 88 062 ■ **Belgium:** Tarkett France Belux – Tel. +32 16 35 98 80 ■ **Denmark:** Tarkett A/S – Tel. +45 43 90 60 11 ■ **Finland:** Tarkett Oy – Tel. +358 9 4257 9000 ■ **France:** Tarkett SAS – Tel. +33 1 41 20 42 49 ■ **Germany:** Tarkett Holding GmbH, Bereich Objekt – Tel. +49 62 33 810 ■ **Greece:** Tarkett Monoprosopi Ltd – Tel. +30 210 6745 340 ■ **Italy:** Tarkett S.p.A. – Tel. +39 0744 7551 ■ **Luxembourg:** Tarkett GDL SA – Tel. +352 949 211 8804 ■ **Netherlands:** Tarkett Holding GmbH, Vestiging Nederland – Tel. +31 416 685 491 ■ **Norway:** Tarkett AS – Tel. +47 32 20 92 00 ■ **Portugal:** Tarkett SA – Tel. +351 21 427 64 20 ■ **Spain:** Tarkett Floors S.L. – Tel. +34 91 358 00 35 ■ **Sweden:** Tarkett Sverige AB – Tel. +46 771 25 19 00 ■ **Switzerland:** Tarkett Holding GmbH, Bereich Objekt Schweiz – Tel. +41 043 233 79 24 ■ **Turkey:** Tarkett Aspen – Tel. +90 212 213 65 80 ■ **United Kingdom:** Tarkett Ltd – Tel. +44 (0) 1622 854 040 ■ **EASTERN EUROPE:** Baltic Countries: Tarkett Baltics – Tel. +370 37 262 220 ■ **Czech Republic:** Tarkett France SAS, org. slozka – Tel. +420-271 001 602 ■ **Hungary:** Tarkett France SAS – Tel. +36 1 437 8150 ■ **Poland:** Tarkett Polska Sp. z o.o. – Tel. +48 22 16 09 231 ■ **Russian Federation:** ZAO Tarkett RUS – Tel. +7 495 775 3737 ■ **Slovakia:** Tarkett France SAS, org. slozka – Tel. +421 248 291 317 ■ **South East Europe:** Tarkett Trade d.o.o. – Tel. +381 21 7557 649 (44) 569 12 21 ■ **Ukraine:** Tarkett UA – Tel. +38 (0) 44 569 12 21 ■ **ASIA AND OCEANIA:** Australia: Tarkett Australia Pty Ltd – Tel. +61 2 88 53 12 00 ■ **China:** Tarkett Floor Covering (Shanghai) Co. Ltd. – Tel. +86 (21) 60 95 68 38 ext 841 ■ **North East Asia:** Tarkett Hong Kong Limited – Tel. +852 2511 8716 ■ **India:** Tarkett France (India Branch) – Tel. +91 11 4352 4073 ■ **South East Asia:** Tarkett Flooring Singapore Pte. Ltd. – Tel. +65 6346 1585 ■ **AFRICA:** Tarkett International: Tel. +33 1 41 20 41 01 ■ **MIDDLE EAST:** Tarkett Middle East: Tel. +961 1 51 3363/4 ■ **Israel:** Tarkett International: Tel. +33 1 41 20 41 01 ■ **NORTH AMERICA:** USA: Tarkett Inc. – Tel. +1 713 869 5811 / Johnsonite – Tel. +1 440 543 8916 ■ **Canada:** Tarkett Inc. – Tel. +1 450 293 173 ■ **LATIN AMERICA:** Brazil: Tarkett – Tel. 55 12 3954 7108 ■ **Argentina - Chile - Uruguay:** Tarkett Latam Mercosur – Tel. +54 11 47 08 07 72 / +54 9 11 44 46 88 82 ■ **Bolivia - Colombia - Ecuador - Panama - Paraguay - Peru - Trinidad and Tobago - Venezuela:** Tarkett – Tel. +55 11 9 8410 9310 / +55 11 95494 0069 ■ **Mexico / Central America:** Tarkett Latam Mexico – Tel. +55 11 98410 9310

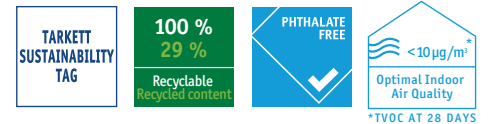

## Logistics Information



## General Information



According to European Classification ISO 10874

